



AURORA Series Unified User's Manual

For AURORA 8 & 8 PRO


Thunder Laser

www.thunderlaser.com tech@thunderlaser.com

October 2023

DONGGUAN THUNDER LASER EQUIPMENT CO., LTD

Dongguan City, Guangdong Province, China

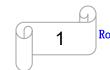



Introduction

This manual has been designated as a user's guide for thunder laser systems and fiber laser machine installation;

The manual is divided into eight chapters, including General Information Instructions, Safety Instructions, Key

Components of every Laser Systems and the Installation Steps, Operation Instructions and Maintenance

Instructions from THUNDERLASER Company.

It should be emphasized that the installation of each system must meet the requirements, and be consistent with the installation requirements of THUNDERLASER. If not, the machine won't work properly, manifested as poor performance, shortened life-span, increasing maintenance costs and even damage to the machine.

The note is about some specific requirements during system installation, and we hope every customer could try to understand these notes before installation and usage, so that you can correctly install and use it. If you meet any problems during installation, you can contact our technical personnel or Customer Service.



Content

1.1 GENERAL INFORMATION	CHAPTER 1. GENERAL	4
1.3 DISPOSAL REMARKS	1.1 General Information	4
1.4 Technical Parameter/Device Specification 6 1.5 ROHS Certificate 8 1.6 MANUFACTURER'S LABEL 9 CHAPTER 2. SAFETY 10 2.1 GENERAL SAFETY INFORMATION 10 2.2 LASTE SAFETY INFORMATION 11 2.3 SAFETY PRECAUTIONS WHEN OPERATING THE DEVICE 12 2.4 WARNING AND INFORMATION LABELS 13 CHAPTER 3. PROCESS OF INSTALLING 15 3.1 UNIVACKING 15 3.2 LOCATION 15 3.3 CONNECTIONS 17 3.3.1 Connecting the Mains 17 3.3.2 CONNECTIONS 17 3.3.3 Connecting the Computer 16 3.3.3 Connecting the exhaust system 16 CHAPTER 4. OPERATION 20 4.1 MACHINE VIEW 20 4.2 How to Use the DISPLAY 22 4.3 How to Use the DISPLAY 22 4.3 How to Use the CAMPERA 23 CHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES 24 5.1 2 Software setting 36 5.2 2 ZCAD3 32 5.2 2 Zotivate the software 35 5.2.3 Software setting 36 </td <td>1.2 Designated</td> <td>5</td>	1.2 Designated	5
1.5 ROHS CERTIFICATE 1.6 MANUFACTURER'S LABEL 2.1 GENERAL SAFETY 2.1 GENERAL SAFETY INFORMATION 2.1 GENERAL SAFETY INFORMATION 3.1 GENERAL SAFETY INFORMATION 3.2 SAFETY PRECAUTIONS WHEN OPERATING THE DEVICE 3.2 SAFETY PRECAUTIONS WHEN OPERATING THE DEVICE 3.3 SAFETY PRECAUTIONS WHEN OPERATING THE DEVICE 3.1 UNPACKING 3.1 UNPACKING 3.1 UNPACKING 3.2 LOCATION 3.3 CONNECTIONS 3.3 CONNECTIONS 3.3 Connecting the Mains 3.3.2 CORNECTIONS 3.3 Connecting the Mains 3.3.2 CORNECTIONS 4.1 MACHINE VIEW 4.2 HOW TO USE THE DISPLAY 4.3 HOW TO USE THE DISPLAY 4.3 HOW TO USE THE DISPLAY 4.3 HOW TO USE THE CAMERA 5.1 EZCAD2 5.1 Driver Installation 5.2 EZCAD3 5.2 LOCATION 5.2 SOFTWARE SETTING 5.2 EZCAD3 5.3 SOFTWARE SETTING 5.3 SOFTWARE SETTING 5.4 SOFTWARE SETTING 5.5 SOFTWARE SETTING 5.7 THE FIRST TIME TO RUN THE FIBER LASER 5.7 THE FIRST TIME TO RUN THE FIBER LASER 5.7 THE FIRST TIME TO RUN THE FIBER LASER 5.7 THE FIRST TIME TO RUN A HIBER LASER 5.7 THE FIRST TIME TO RUN A HIBER LASER 5.7 THE FIRST TIME TO RUN A HIBER LASER 5.7 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE	1.3 Disposal remarks	5
1.6 MANUFACTURER'S LABEL	1.4 TECHNICAL PARAMETER/DEVICE SPECIFICATION	6
CHAPTER 2. SAFETY 10 2.1 GENERAL SAFETY INFORMATION 10 2.2 LASER SAFETY INFORMATION 11 2.3 SAFETY PRECAUTIONS WHEN OPERATING THE DEVICE 12 2.4 WARNING AND INFORMATION LABELS 13 CHAPTER 3. PROCESS OF INSTALLING 15 3.1 UNPACKING 15 3.2 LOCATION 15 3.3 CONNECTIONS 17 3.3.1 Connecting the Mains 17 3.3.2 Connecting the Computer 16 3.3.2 Connecting the exhaust system 16 CHAPTER 4. OPERATION 20 4.1 MACHINE VIEW 20 4.2 HOW TO USE THE DISPLAY 22 4.2 HOW TO USE THE DISPLAY 22 4.3 HOW TO USE THE INTRODUCTION TO SOFTWARES 24 5.1 EZCAD2 24 5.1 Driver Installation 26 5.2 L Zoftware setting 30 5.2 L Zoftware setting 30 5.2 L Zoftware setting 32 5.2 L Activate the software 33 5.2 Software setting 45 5.2 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER <	1.5 ROHS CERTIFICATE	8
2.1 General Safety Information	1.6 Manufacturer's Label	9
2.2 LASER SAFETY INFORMATION 11 2.3 SAFETY PRECAUTIONS WHEN OPERATING THE DEVICE 12 2.4 WARNING AND INFORMATION LABELS 13 CHAPTER 3. PROCESS OF INSTALLING 15 3.1 UNPACKING 15 3.2 LOCATION 15 3.3 CONNECTIONS 17 3.3.1 Connecting the Mains 17 3.3.2 Connecting the Computer 18 3.3.3 Connecting the exhaust system 16 CHAPTER 4. OPERATION 20 4.1 MACHINE VIEW 20 4.2 HOW TO USE THE DISPLAY 22 4.3 HOW TO USE THE CAMERA 23 CHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES 24 5.1 EZCAD2 24 5.1.2 Software setting 36 5.2 EZCAD3 32 5.2.1 Driver Installation 22 5.2.2 Software setting 33 5.2.3 Software setting 35 5.2.4 Crivate the software 35 5.2.3 Software setting 35 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO	CHAPTER 2. SAFETY	10
2.3 SAFETY PRECAUTIONS WHEN OPERATING THE DEVICE 12 2.4 WARNING AND INFORMATION LABELS 13 CCHAPTER 3. PROCESS OF INSTALLING 15 3.1 UNPACKING 15 3.2 LOCATION 15 3.3 CONNECTIONS 17 3.3.1 Connecting the Mains 27 3.3.2 Connecting the Computer 26 3.3.3 Connecting the exhaust system 16 CHAPTER 4. OPERATION 20 4.1 MACHINE VIEW 20 4.2 HOW TO USE THE CAMERA 23 CCHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES 24 5.1 EZCAD2 24 5.1 Driver Installation 25 5.2 EZCAD3 32 5.2 L Zoftwate the software 33 5.2 L Priver Installation 33 5.2 L Zortvate the software 34 5.2 Activate the software 35 5.2.3 Software setting 45 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 The FIRST TIME TO RUN A PIBER LASER 50 7.2 THE FIRST TIME TO RUN A LASER 57	2.1 General Safety Information	10
2.4 WARNING AND INFORMATION LABELS 13 CHAPTER 3. PROCESS OF INSTALLING 15 3.1 UNPACKING 15 3.2 LOCATION 15 3.3 CONNECTIONS 17 3.3.1 Connecting the Mains 17 3.3.2 Connecting the Computer 18 3.3.2 Connecting the exhaust system 18 CHAPTER 4. OPERATION 20 4.1 MACHINE VIEW 20 4.2 HOW TO USE THE DISPLAY 22 4.3 HOW TO USE THE CAMERA 23 CHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES 24 5.1 EZCAD2 24 5.1 Driver Installation 26 5.1.2 Software setting 33 5.2 EZCAD3 32 5.2.1 Driver Installation 33 5.2.2 Activate the software 36 5.2.3 Software setting 43 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN A FIBER LASER 50 7.1 The FIRST TIME TO RUN A FIBER LASER 50 7.2 The FIRST TIME TO RUN A UN LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAI	2.2 Laser Safety Information	11
CHAPTER 3. PROCESS OF INSTALLING 15 3.1 UNPACKING 15 3.2 LOCATION 15 3.3 CONNECTIONS 17 3.3.1 Connecting the Mains 17 3.3.2 Connecting the Computer 16 3.3.3 Connecting the exhaust system 16 CHAPTER 4. OPERATION 20 4.1 MACHINE VIEW 20 4.2 HOW TO USE THE DISPLAY 22 4.3 HOW TO USE THE CAMERA 23 CCHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES 24 5.1 EZCAD2 24 5.1 Driver Installation 25 5.2 Software setting 30 5.2 L Driver Installation 33 5.2.1 Driver Installation 33 5.2.2 Activate the software 33 5.2.3 Software setting 33 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A HIBER LASER 50 7.2 THE FIRST TIME TO RUN A HIBER LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	2.3 Safety Precautions when Operating the Device	12
3.1 UNPACKING 15 3.2 LOCATION 15 3.3 CONNECTIONS 17 3.3.1 Connecting the Mains 17 3.3.2 Connecting the exhaust system 16 CHAPTER 4. OPERATION 26 4.1 MACHINE VIEW 26 4.2 HOW TO USE THE DISPLAY 22 4.3 HOW TO USE THE CAMERA 23 CHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES 24 5.1 EZCAD2 24 5.1.1 Driver Installation 26 5.2 EZCAD3 33 5.2 EZCAD3 32 5.2.1 Driver Installation 33 5.2.2 Activate the software 33 5.2.3 Software setting 33 5.2.4 Activate the software 33 5.2.3 Software setting 35 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A BER LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	2.4 Warning and Information Labels	13
3.2 LOCATION	CHAPTER 3. PROCESS OF INSTALLING	15
3.3 CONNECTIONS 17 3.3.1 Connecting the Mains 17 3.3.2 Connecting the Computer 16 3.3.3 Connecting the exhaust system 16 CHAPTER 4. OPERATION 20 4.1 MACHINE VIEW 20 4.2 HOW TO USE THE DISPLAY 22 4.3 HOW TO USE THE CAMERA 23 CHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES 24 5.1 EZCAD2 24 5.1.1 Driver Installation 25 5.2 EZCAD3 36 5.2 EZCAD3 32 5.2.1 Driver Installation 33 5.2.2 Activate the software 35 5.2.3 Software setting 43 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A BUSH LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	3.1 Unpacking	15
3.3.1 Connecting the Mains 17 3.3.2 Connecting the Computer 18 3.3.3 Connecting the exhaust system 16 CHAPTER 4. OPERATION 20 4.1 MACHINE VIEW 20 4.2 HOW TO USE THE DISPLAY 22 4.3 HOW TO USE THE CAMERA 23 CHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES 24 5.1 EZCAD2 24 5.1.2 Software setting 36 5.2 EZCAD3 32 5.2.1 Driver Installation 33 5.2.2 Activate the software 35 5.2.3 Software setting 43 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A UV LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	3.2 Location	15
3.3.2 Connecting the Computer 16 3.3.3 Connecting the exhaust system 16 CCHAPTER 4. OPERATION 20 4.1 MACHINE VIEW 20 4.2 HOW TO USE THE DISPLAY 22 4.3 HOW TO USE THE CAMERA 23 CCHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES 24 5.1 EZCAD2 24 5.1.2 Software setting 30 5.2 EZCAD3 32 5.2.1 Driver Installation 33 5.2.2 Activate the software 33 5.2.3 Software setting 43 CCHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CCHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A UV LASER 57 CCHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	3.3 Connections	17
3.3.3 Connecting the exhaust system 16 CHAPTER 4. OPERATION 20 4.1 MACHINE VIEW 20 4.2 HOW TO USE THE DISPLAY 22 4.3 HOW TO USE THE CAMERA 23 CHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES 24 5.1 EZCAD2 24 5.1.1 Driver Installation 25 5.1.2 Software setting 30 5.2 EZCAD3 32 5.2.1 Driver Installation 33 5.2.2 Activate the software 33 5.2.3 Software setting 45 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A UV LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	3.3.1 Connecting the Mains	
CHAPTER 4. OPERATION 20 4.1 MACHINE VIEW 20 4.2 HOW TO USE THE DISPLAY 22 4.3 HOW TO USE THE CAMERA 23 CHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES 24 5.1 EZCAD2 24 5.1.1 Driver Installation 26 5.1.2 Software setting 30 5.2 EZCAD3 32 5.2.1 Driver Installation 33 5.2.2 Activate the software 35 5.2.3 Software setting 43 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A UV LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	3.3.2 Connecting the Computer	18
4.1 MACHINE VIEW 20 4.2 HOW TO USE THE DISPLAY 22 4.3 HOW TO USE THE CAMERA 23 CHAPTER 5, BRIEF INTRODUCTION TO SOFTWARES 24 5.1 EZCAD2 24 5.1.1 Driver Installation 25 5.1.2 Software setting 30 5.2 EZCAD3 32 5.2.1 Driver Installation 33 5.2.2 Activate the software 35 5.2.3 Software setting 43 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A UV LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	3.3.3 Connecting the exhaust system	18
4.2 HOW TO USE THE DISPLAY. 22 4.3 HOW TO USE THE CAMERA. 23 CHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES. 24 5.1 EZCAD2. 24 5.1.1 Driver Installation 26 5.1.2 Software setting. 36 5.2 EZCAD3. 32 5.2.1 Driver Installation. 33 5.2.2 Activate the software. 35 5.2.3 Software setting. 43 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS. 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER. 50 7.1 THE FIRST TIME TO RUN A FIBER LASER. 50 7.2 THE FIRST TIME TO RUN A UV LASER. 57 CHAPTER 8 MAINTENANCE. 64 8.1 GENERAL MAINTENANCE. 64	CHAPTER 4. OPERATION	20
4.3 HOW TO USE THE CAMERA 23 CHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES 24 5.1 EZCAD2 24 5.1.1 Driver Installation 25 5.1.2 Software setting 36 5.2 EZCAD3 32 5.2.1 Driver Installation 33 5.2.2 Activate the software 35 5.2.3 Software setting 43 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A UV LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	4.1 MACHINE VIEW	20
CHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES 24 5.1 EZCAD2 24 5.1.1 Driver Installation 25 5.1.2 Software setting 30 5.2 EZCAD3 32 5.2.1 Driver Installation 33 5.2.2 Activate the software 35 5.2.3 Software setting 45 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A UV LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	4.2 How to use the display	22
5.1 EZCAD2 24 5.1.1 Driver Installation 25 5.1.2 Software setting 30 5.2 EZCAD3 32 5.2.1 Driver Installation 33 5.2.2 Activate the software 39 5.2.3 Software setting 43 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A UV LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	4.3 How to use the camera	23
5.1.1 Driver Installation 25 5.1.2 Software setting 30 5.2 EzCAD3 32 5.2.1 Driver Installation 33 5.2.2 Activate the software 39 5.2.3 Software setting 43 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A UV LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	CHAPTER 5. BRIEF INTRODUCTION TO SOFTWARES	24
5.1.2 Software setting 36 5.2 EzCad3 32 5.2.1 Driver Installation 33 5.2.2 Activate the software 39 5.2.3 Software setting 43 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A UV LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	5.1 EzCAD2	24
5.2 EZCAD3 32 5.2.1 Driver Installation 33 5.2.2 Activate the software 39 5.2.3 Software setting 43 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A UV LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	5.1.1 Driver Installation	25
5.2.1 Driver Installation 33 5.2.2 Activate the software 39 5.2.3 Software setting 43 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A UV LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	5.1.2 Software setting	30
5.2.2 Activate the software 39 5.2.3 Software setting 43 CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS 45 CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER 50 7.1 THE FIRST TIME TO RUN A FIBER LASER 50 7.2 THE FIRST TIME TO RUN A UV LASER 57 CHAPTER 8 MAINTENANCE 64 8.1 GENERAL MAINTENANCE 64	5.2 EzCad3	32
5.2.3 Software setting		
CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS		
CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER	5.2.3 Software setting	43
7.1 The first time to run a fiber laser	CHAPTER 6. HOW TO SET & ADJUST THE FOCUS LENGTH OF AUTO-FOCUS	45
7.2 The first time to run a UV laser	CHAPTER 7 THE FIRST TIME TO RUN THE FIBER LASER	50
CHAPTER 8 MAINTENANCE 64 8.1 General Maintenance 64	7.1 The first time to run a fiber laser	50
8.1 General Maintenance	7.2 The first time to run a UV laser	57
	CHAPTER 8 MAINTENANCE	64
8.2 CLEAN THE FIELD LENS64	8.1 General Maintenance	64
	8.2 Clean the Field lens64	



Chapter 1. General

1.1 General Information

Please read this documentation carefully before installation and operation.

Injury, death, property loss, fire, electric shock, malfunction, reduced performance & machine

life-span, and serious failures might happen unless you read, understand, and follow the

Operation Manual!

Operation of the system is permitted only with equipment and spare parts supplied or listed in the *List of Spare*Parts and Consumables. The use of components from the 3rd Party may invalidate the warranty.

Auxiliary equipment must be adjusted to the base machine (contact us for further info).

The following symbols are used throughout the Operation Manual:



Caution: When operating the laser, keep alarmed all the time.



High Voltage: Be careful to prevent injury and/or death.



Laser Radiation: Keep away from the dangers of the laser beam.



Fire Hazard: High potential for fire. NEVER LEAVE IT UNATTENDED WHEN RUNNING!



Tips: Helpful notes or info can make it easier to use or understand.





1.2 Designated

The THUNDER LASER AURORA SERIES is intended exclusively for laser marking through the supplied marking software.

Materials such as metal, anodized aluminum, and several plastics can be processed by the laser.

As part of the intended use, the following points should also be observed:



- 1. The engraving process must only be performed with a perfectly adjusted machine.
- 2. Only mark approved materials with suitable parameters.
- 3. Use of the system in other areas is against the designated use. The manufacturer does not admit liability for damage to personal and/or equipment resulting from such use.
- 4. The system must only be operated, maintained and repaired, by personnel that are familiar with the designated field of use and the dangers of the machine!
- 5. Non-observance of the instructions for operation, maintenance and repair described in this operation Manual excludes any liability of the manufacturer if a defect occurs.
- 6. Caution when processing conductive materials (carbon fibers), conductive dust or particles in the ambient air might damage electrical components and lead to short circuits. Bear in mind that those defects are not warranted.

1.3 Disposal remarks



Do not dispose the machine with house refuse!

Electronic devices have to be disposed along with electric waste disposal according to the regional directives on electronic. For further questions, please ask your supplier. He might handle it properly.

5



1.4 Technical Parameter/Device Specification

Mechanics

	AURC	RA 8		AURORA 8 PRO				
Max marking area	200*200mm/7.9"							
Max working area		200*200mm/7.9"						
Lens(Fiber and Mopa)	Marking area	Max work height	Focus diame	eter Focus length				
F-160	4.3"×4.3"/110×110mm	7.9"/200mm	25.95µm	7.1"/180mm				
F-220	5.9"×5.9"/150×150mm	4.5"/115mm	40.9µm	9.5"/233mm				
F-290	7.9"×7.9"/200×200mm	1.2"/30mm	47µm	13.8"/350mm				
Lens(uv)	Marking area	Marking area Max work height F		eter Focus length				
F-170	3.9"×3.9"/100×100mm	5.7"/144mm	11.04µm	212mm				
F-254	5.9"×5.9"/150×150mm	1.3"/34mm	16.5µm	308mm				
Max marking speed	2m/sec, 200cps 8m/sec, 800cps							
Z-axis		Motorized Z-ax	is, 15.4"/390mm					
Table		Alumina table, 14.7	"×11.5"/374×293	Bmm				
Net weight	UV Series: 92.5kgs 71kgs/15		s/157lbs	72kgs/159lbs				
Housing	29.7"×16.9"×30.9"/755*430*786mm							
dimensions(W*D*H)	(UV Series: 30.3"×16.9"×30.9"/770*430*786mm)							
PS	AURORA 8 is fitted with F-160 as standard, and 8 PRO with F-220.							
го	The UV Series is fitted with F170 as standard.							

Laser Equipment

	AURORA 8&AURORA 8 PRO					
Laser power	UV 5w	fiber 20w	fiber 50w	20w(MOPA)	60w(MOPA)	100w(MOPA)
Wavelength	355nm	1064nm				
Frequency	20-150kHz	20-60kHz	20-60kHz 50-100kHz 1-4000kHz			
Pulse width	1	1	/ / 2-500ns			
Q-pulse width	1-50µs /					
Cooling	Air cooled					
Red dot	Laser Power<1mW, 630-680nm					
pointer						



а

Control System

	AURORA 8	AURORA 8 PRO				
Computer	Microsoft Windows XP, VISTA, Win7, Win10					
Interfaces	US	USB				
Marking software	EzCad2	EzCad3				
Correction software	CorFile2	Calibration Wizard				
Auto-focus software	TL-tool					
1	Fiber 20, 50W adjustable from 10% - 100%					
Laser power	MOPA 20W, 60W adjustable from 0 - 100%					

Electricity, Power, Breaker

	UV 5W	20WATT	50WATT	20WATT(MOPA)	60WATT(MOPA)	100WATT(MOPA)
Electricity requirement	115~230 Volt AC, 50 or 60Hz, Single phase					
Power consumption	300W	230W	340W	225W		
Current	3A, 115V 2.5A, 115V 3.5A,115V 2.5A,115V 2.5A,230V 1.5A, 230V 2A, 230V 1.5A,230V					
Recommended circuit breaker	10A					

Ambient Conditions

Ambient temperature Operating temperature 0°C-40°C

Humidity Maximum humidity 80%

Laser Safety

Laser class Class II

CE-Compliant approved by FDA



1.5 RoHS Certificate



CERTIFICATE

ATTESTATION CERTIFICATE OF ELECTROMAGNETIC COMPATIBILITY AND LOW VOLTAGE DIRECTIVES

Technical file of the company mentioned below has been observed and audit has been completed successfully.

2014/30/EU Electromagnetic Compatibility Directive and

2014/35/EU Low Voltage Directives have been taken as references for these processes

Company Name : Dongguan Thunderlaser Industrial Co., Ltd.

Company Address : 109, Building 2, 159 Shatian Avenue, Shatian Town, Dongguan

city, Guangdong Province, China, 523980a

Related Directives and Annex : 2014/35/EU Low Voltage Directive

2014/30/EU Electromagnetic Compatibility Directive

Related Standards : EN IEC 61000-6-4:2019, EN IEC 61000-3-2:2019

EN 61000-3-3:2013+A1:2019, EN IEC 61000-6-2:2019

EN 60204-1:2018

Product Name : Laser marking

Report No and Date : ZTL-2021121002S

Product Brand/Model/Type : THUNDERLASER//AURORA 8, AURORA 16, AURORA 24,

AURORA 32, AURORA 40

Certificate Number : M.2021.206.C69897

Initial Assessment Date : 17.12.2021

Registration Date : 20.12.2021

Reissue Date/No : -

Expiry Date : 19.12.2026

The validity of the certificate can be checked through www.udem.com.tr. The CE mark shown on the right can only be used under the responsibility of the manufacturer with the completion of EC Declaration of Confamily for all the relevant Directives. This certificate remains the property of UDEM international Certification Auditing Training Centre Industry and Trade Inc. Co. to whom it must be returned upon request. The above named firm must keep a copy of this certificate for 15 years from the registration of certificate. This certificate only covers the product(s) stated above and UDEM must be noticed in case of any changes on the product(s)

Address: Mutlukent Mahallesi 2073 Sokak (Eski 93 Sokak) No:10 Çankaya – Ankara – TURKEY

Phone: +90 0312 443 03 90 Fax: +90 0312 443 03 76 E-mail: info@udemitd.com.tr www.udem.com.tr



Auditing Training Centre Industry

Certification

DONGGUAN THUNDER LASER EQUIPMENT CO., LTD Room1101, Building 3, No. 68, Xingzhou Road, Shatian Town, Dongguan City, Guangdong Province, China




1.6 Manufacturer's Label

The Manufacturer's Label is on the backside of the machine (see picture below)



It is recommended to record all of the data for access anywhere anytime. You will need to supply your Serial Number to our Support Team on occasion.

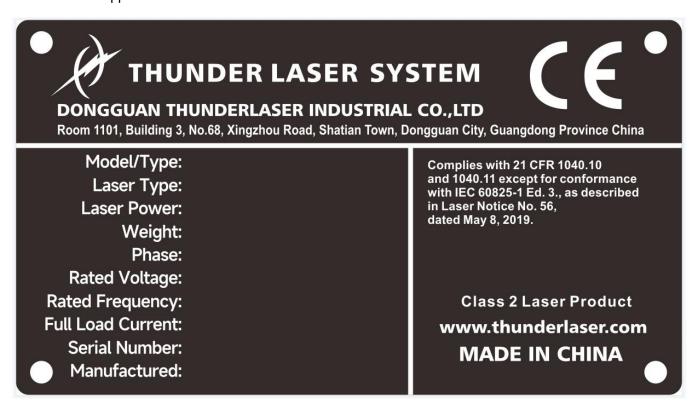



Chapter 2. Safety

2.1 General Safety Information

Any personnel involved in installation, set-up, operation, maintenance and repair of the machine, should have read and understood the Operation Manual, particularly for the "Safety" section. The user is recommended to assign specific company-internal personnel to implement each operation according to the qualifications the employees. And the receipt of the instruction/Operation Manual or the participation at introduction/training should be acknowledged in writing in each case.

Safety -conscious working

The machine must only be operated by trained and authorized personnel.

The scopes of different applicable operations of the machine must be clarified and observed in case of some problems related to safety. Especially for operations on the electric equipment, which must be performed by special experts only.

For all manipulations concerning modifications, maintenance, inspection and repair of installation, set-up, start-up, operation, conditions and operation methods, the switch-off procedures that may be provided in the Operation Manual must be observed.

Safety Information for the User and/or Operating Personnel



- ▲1. Any operating methods that will imperil the safety of the working machine are forbidden.
- 2. The operator must also ensure that no unauthorized person work with the machine (e.g. activating equipment without authorization).
- 3. It is the duty of the operator to check the machine before starting for externally-visible damage or flaws, and to report changes (including behavior during operation) that imperils the safety.
- 4. The user must ensure that the machine is only operated in sound condition.
- 5. The user must guarantee the cleanness and accessibility at and around the machine by corresponding instructions and controls.

10

6. No removing or interrupting safety components (we emphasize again the imminent dangers, for example severe burns, loss of eyesight, etc.). If the removal of safety components is required during repair and service, the replacement of the safety components must be performed immediately after repairing.

www.thunderlaser.com tech@thunderlaser.com Tel:(86) 18103043363



AURORA SERIES

- 7. Preparation, retooling, change of workpiece, maintenance and repair must be performed only with equipment switched off and by trained personnel.
- 8. Any attempt to perform unauthorized modifications and changes to the machine can **INVALIDATE THE WARRANTY.** This does not conform to Thunder Laser's routine preventive & general maintenance, adjustment and alignment, etc.

2.2 Laser Safety Information



1. According to the assessment of the potential danger of the laser systems, the machine is classified into SECURITY CLASS 2. Thunder Laser AURORA series is a device of SECURITY CLASS 2, which is guaranteed by the protective housing and the safety installations.

Attention: Improper operation and maintenance of the device can change the security level and cause the emission of harmful radiation.

2. Without safety precautions, exposure to laser radiation will cause the following risks:

Eyes: Corneal burn

Skin: Burns

Clothing: Danger of fire

- 3. Never try to modify or disassemble the laser or start up a modified or disassembled system!
- 4. Other inappropriate operation or adjustment will cause dangerous radiation exposure other than those described here.



2.3 Safety Precautions when Operating the Device

Your Thunder Laser AURORA SERIES has an integrated safety system which immediately stops running when the protection cover (Lid) is opened. Opening the cover during the operation will interrupt the engraving.

Please remember the following safety precautions when working with this device:


- 1. CO2 Fire extinguishers should be placed near laser. Always keep a properly maintained and inspected fire extinguisher on hand.
- 2. Do not store any inflammables inside of the device. Particularly, leftovers of processed materials have to be removed to prevent fire hazard.
- 3. Please maintain free airflow around this system all the time. Do not cover the machine during operation.
- 4. Stay with the laser. Do not leave the laser unattended when it is working.
 - 1. These lasers emit invisible radiation, so safety glasses should be worn when maintaining these machines for protection.
 - 2. Adjustment of the beam path must be performed only by professionally trained personnel. Any non-standard setting can lead to uncontrollable emission of the laser radiation.
 - 1. Do not disable limit switches or safety devices as this can invalidate warranties and cause damage to you and the machine.
 - 2. Before processing, please verify whether harmful materials can be generated and whether the equipment for exhaust and filtration is useful in dealing with the harmful materials. We need to emphasize that it is the responsibility of the user to consider the national and regional boundary value (the maximum permitted emission concentration) for dust, fogs and gases when selecting the system for exhaust and filtration.
- 3. Under no circumstances can PVC (polyvinyl chloride) be processed with the laser.




2.4 Warning and Information Labels




The warning and information labels in various locations of the machine should always be carefully read and understood. If labels are lost or damaged, they must be replaced immediately.

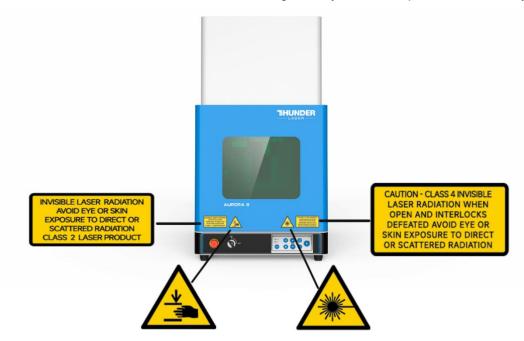

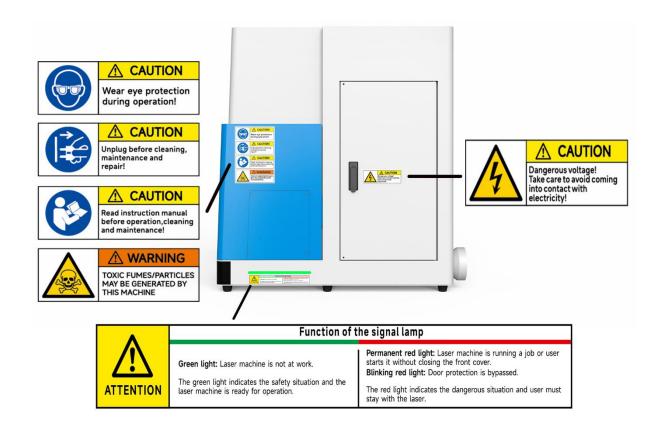



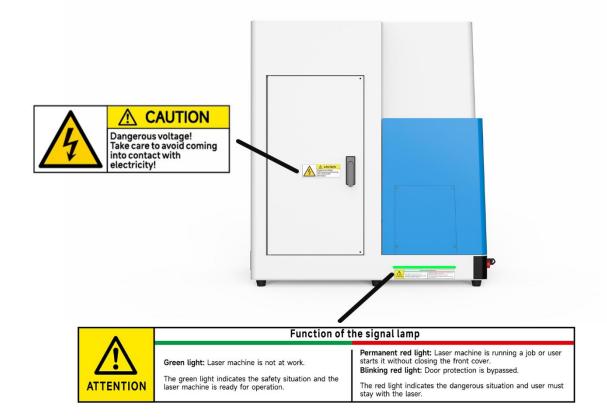





Chapter 3. Process of Installing

3.1 Unpacking

When you receive your THUNDER LASER AURORA SERIES, it's packed in a wooden box which contains the laser machine and additional accessories. The steps for unpacking and assembling of the laser are as follows. Please follow them carefully.



Keep the packing box. You will need it in case of a return.

Dispose all waste according to the applicable waste disposal rules

- 1. Put the wooden box in a flat and spacious room for unpacking.
- 2. Remove the machine box; carefully remove the protective foam, wraps, films, etc.
- 3. Please keep the warranty certificate as well as the model and serial number of the machine. If you need tech support, please tell us these.
- 4. Then start to install the machine, carefully following the instructions in this manual.

3.2 Location

Before installing the fiber laser system, you should select an appropriate location. Follow the guidelines shown below:



- 1. Avoid locations of high temperature, much dust and high humidity. (The humidity should be kept within 70% and the recommended operating environment temperature range of the laser is 0-40°C.)
- 2. Avoid locations where the system is exposed to mechanical shocks.



- 1. Circuit Breaker protection: Do not connect other devices on the same circuit as that of the laser system. It requires a dedicated circuit.
- 2. DO NOT open any of the machine's access panels while the unit is plugged in. Opening any panel may expose the operator to severe electric shock, invisible laser radiation, mechanical pinch points, burns, blindness, and other hazards. POWER OFF AND UNPLUG after using!
- 3. DO NOT make or break any electrical connections to the system while the unit is turned on.

15





- 1. Avoid locations with poor air circulation; select a location close to ventilation (if available). Select a location, whose room temperature is between 15 °C and 25°C (59°F 77° F).
- 2. This is fundamental to maintain consistent and reliable operation of a fiber laser and the machine itself. Avoid higher ambient temperatures and strong exposure of the engraver to strong sunlight. Use blinds, if needed.
- 3. Mechanical shock and vibration of the laser will have detrimental effects on the performance and life expectancy of the machine. It will manifest (over a period of time) with a noticeable decrease in performance and need for maintenance, even breakdown, possibly. Setting your Thunder Fiber Laser up in s suitable controlled temperature, dust free, moisture free, level, stable surface (a level concrete floor) with the recommended maintenance method is critical to the ongoing performance of the machine. It is also a premise for warranty.



3.3 Connections

Perform the connections exactly in the order described; otherwise the static electricity can damage your computer and/or the electronics of the laser system.

3.3.1 Connecting the Mains

Connect one end of the mains cable with the connection socket at the rear side of the laser device (see figures below) and the other end with a protected power outlet.

Mains voltage must correspond with the operating voltage (AC 110V~240V 50/60 Hz) – see information on label beside the connection socket.



Under no circumstances should you switch on the device if the voltages do not correspond with each





3.3.2 Connecting the Computer

AURORA 8

Connecting the computer and the machine by using the USB cable, as shown in the picture below:





About how to start to use software EzCad2, refer to chapter 5.1 EzCad2.




The USB cable is placed inside the toolbox.

3.3.3 Connecting the exhaust system

Insert one side of the gray exhaust pipe into the fan inlet and the other side into the machine behind the exhaust tank. Insert one side of the other gray exhaust pipe into the fan outlet and put the other side of the pipe outside the operation room (If the machine is too far from the door of the room to discharge the gas manufactured; then you might need a dust/fume filter, it can keep good air quality of your working environment).

Please refer to the following pictures about how to install the exhaust pipe:



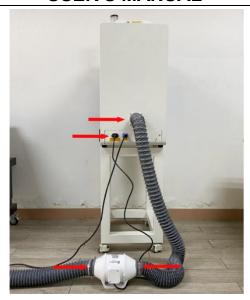

The input voltage must correspond to the required range (AC 110V~240V 50/60 Hz) – see information label beside the connection socket.





Chapter 4. Operation

4.1 Machine view

1. Left side door

On fiber laser, there are installed Z motor and Driver, Z limit switches.

Please open this door for checking these parts, but you must pay attention to the electric current.

2. Rotary connector

Use to connect the rotary.

3. Camera

Using camera function.

4. Exhaust hole

This is for exhausting the fume.

5. Indicator light

If fiber laser machine is running, the signal lamp is in red light.

If the laser machine is on standby, the signal lamp is in green light.

6. Flap protection sensor

This is where the switch for flap protection exist. Laser will stop working once the cover is opened during working.

7. Emergency stop button

Once there's an accident during operation, please press this button immediately. And then the laser power and motion power will be cut off immediately.

8. Key switch

To turning the machine on.

9. Operate panel


Control auto-focus, galvo movement, etc.

10. F-lens

You can replace the field lens by rotating it.

11. Galvanometer

Composed of two parts: optical scanning device and servo control.

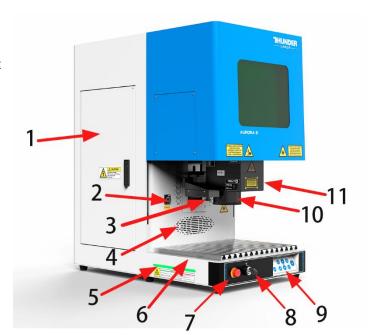



12. Front door

Close it to run a file.

13. Protection glass

Protect eyes from laser reflection.

14. Pass-through door

User can remove it to marking some longer objects.



15. Cooling fan

Cooling the electricity parts.

16. Exhaust hose

Install the exhaust pipe.

17. PC connection port (USB)

This USB is for connecting computer.

18. Main power socket

To connect the main power.

19. Manufacture's label


The device information is listed, such as serial number, manufacturing date and etc.

20 16 19

20. Exhaust fan socket


To connect the main power of exhaust fan.

www.thunderlaser.com tech@thunderlaser.com Tel:(86) 18103043363

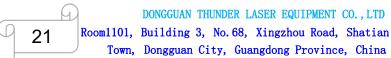



4.2 How to use the display

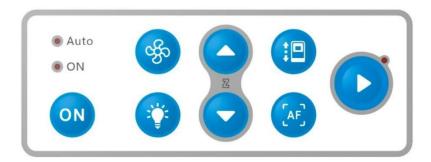

Auto

ON

Auto and ON: Auto is red means that an automatic door is installed on the laser, otherwise not.

On is red means the laser is ready, flashing means the laser needs to initialize.

Auto and On are all off means the emergency is pressed.


On button: Initialize button, user needs press this button after rebooting the machine.

Fan mode switching: In standard mode, the exhaust fan will always on. In auto mode, the fan will be on after marking.

Light button: Control the lighting of the work table, the light is divided into four brightness (the brightest by default for the power on).



Z button: Control the galvo to move.

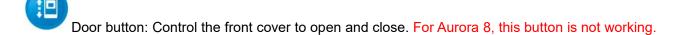

Auto focus button: Press it, the galvo will adjust the focal length automatically.





4.3 How to use the camera

There is a camera equipped with Aurora.

You can check the marking progress through the camera.



Open the camera app of your computer, and use the rear camera. User can check the work table when marking, like below.





Chapter 5. Brief Introduction to Softwares

For AURORA 8 and AURORA 8 PRO, the software is different. Please note which one is what you need.

	AURORA 8 AURORA 8 PRO	
Software	EzCad2	EzCad3

5.1 EzCad2

The EzCad2 software runs on a PC with 900 MHz CPU and 256 MB RAM at least. In general, we recommend the fastest PC available. EzCad2 was developed in Microsoft Windows XP and will run in Windows XP, WIN7, WIN10 and VISTA.

The installation of EzCad2 is very easy. Users just need to copy EzCad2 folder in the Install FOLDER to hard disk, and then double click the Ezcad2.exe under the EzCad2's directory to run the software.

If users run the software without connecting the fiber laser, a caution will appear and the software will work at demo state. In demo state, we can evaluate the software but we cannot save files and cannot control the laser device.



The Software, Drive and Correction file are in the U-disk that came with the fiber machine.



5.1.1 Driver Installation

Turn on the fiber laser.

Connect your fiber laser with PC via USB cable.




Before moving on to the next step, please save the Driver file in the U- disk to your computer, and remember where it is.


How to choose correct driver for fiber and uv laser.

Driver of fiber



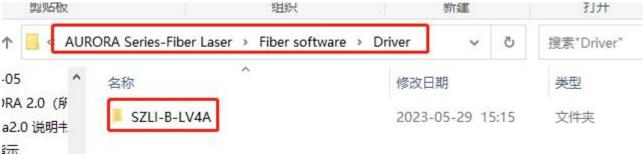



1. Go Manage>>Device manager>>Other devices>>USBLMCV2>>right click, Update driver>>Browse my computer for driver software>>Browse, and find the CV4 folder you saved from the U-disk that came with the fiber laser>>Select the CV4 driver>>Next>>Install, then the driver is installed successfully. See pictures below.

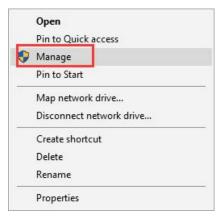

Pic1




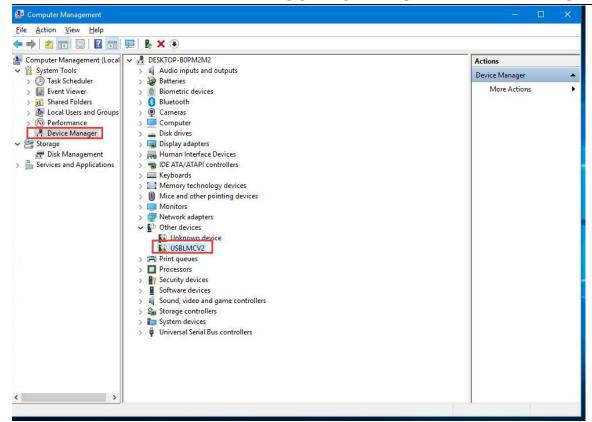


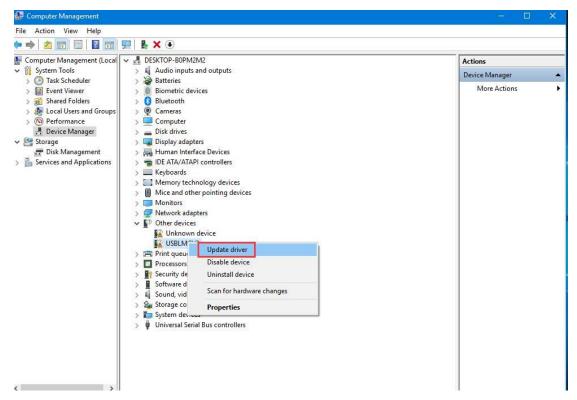


Pic3




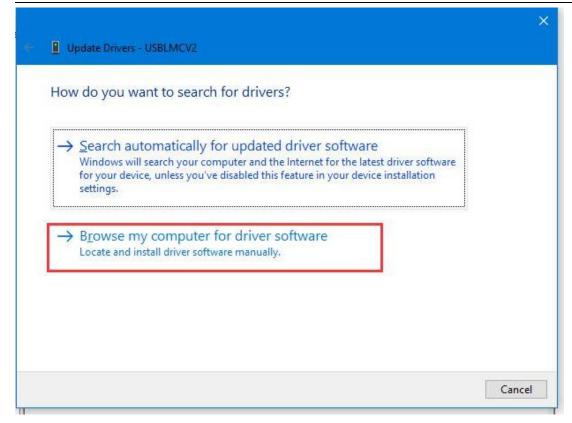

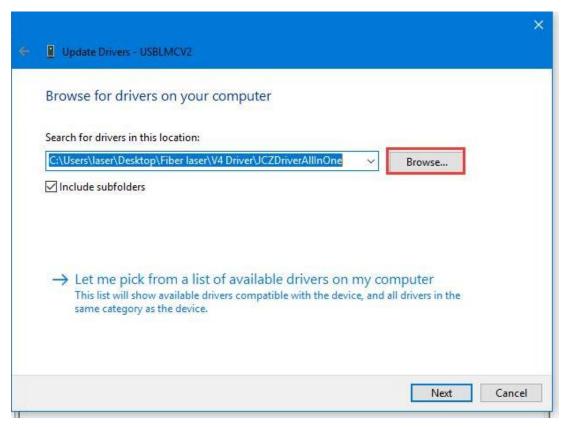




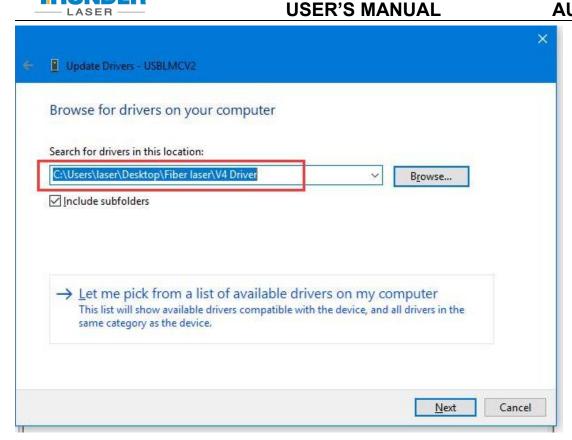


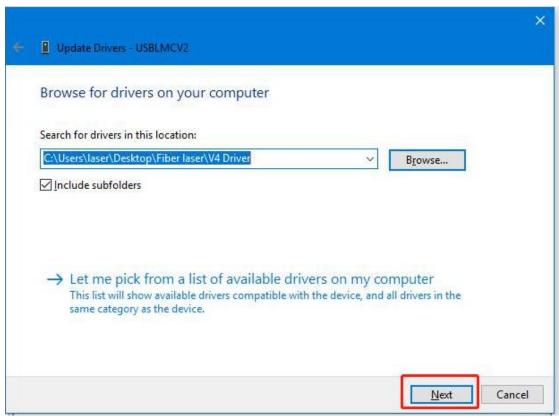

28



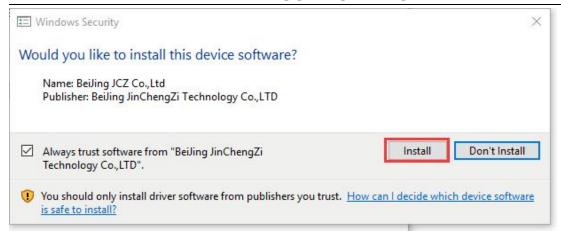

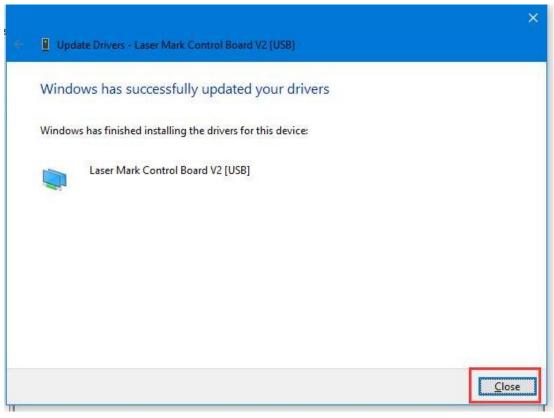

Pic9

Then, you can open the software now.



5.1.2 Software setting

1. General setting

Fiber


Open the software, then press "F3" and select items according to the picture below (take AURORA 20W as an example) .

Laser type: Fiber

PWM:

Max PWM: 60 kHz, Min PWM: 20 kHz.

Fiber serial: IPG_YLP Open Mo Delay: 8ms.

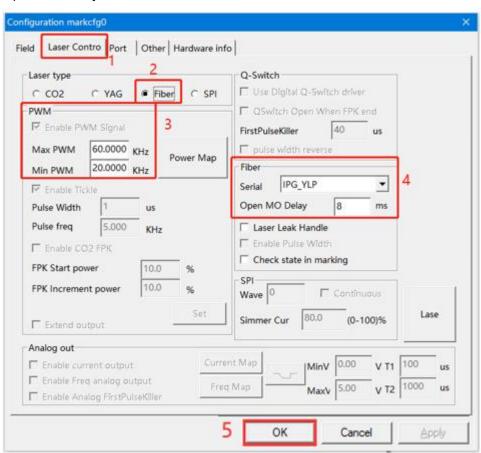



The frequency ranges for different laser source.

UV laser	5W				
Fiber laser		20W	50W		
MOPA laser				20W	60W
Frequency	20-150kHz	20-60kHz	50-100kHz	1-4000kHz	

And we set all setting above before leaving the factory, so just check if these are correct. If not, change them according.

www.thunderlaser.com tech@thunderlaser.com Tel:(86) 18103043363





UV


If your laser source is an uv 5w, please check according to below instruction.

Open the software, then press "F3" and select items according to the picture below

Laser type: YAG

PWM:

Max PWM: 150 kHz, Min PWM: 20 kHz.

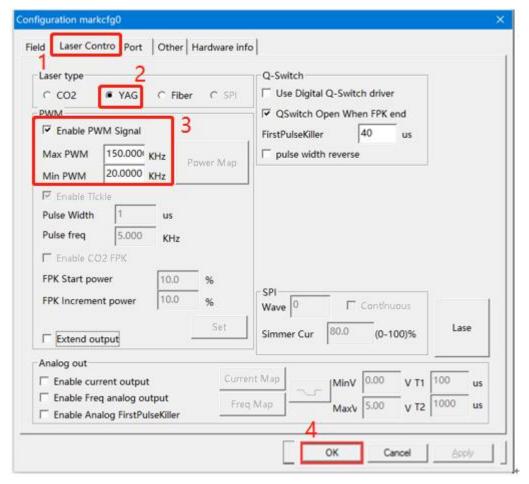

2. How to import the calibration file




- 1. Before leaving the factory, we have done a correction test for each machine and imported the calibration file to fiber software, so the customer does not need to calibrate again.
- 2. Different field lenses have different calibrate files and cannot be used randomly.
- 3. If you've purchased other field lens with the fiber machine, we will prepare the calibration file and put it in the U disk too.
- 4. If you've purchased other field lens after the machine left the factory, contact us to get the calibration file.

Open the software>>Press "F3" button>>Field>>find the calibration file (say the name is110×110.cor) in the USB disk that came with the machine.

www.thunderlaser.com tech@thunderlaser.com Tel:(86) 18103043363





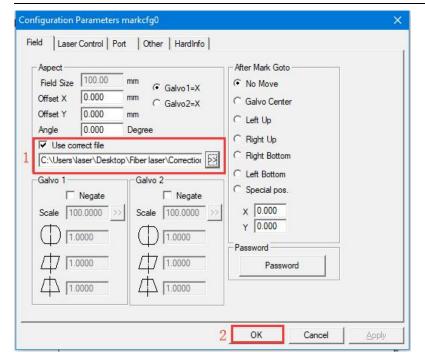

Customer can save the calibration file to computer from U-disk, and select it from computer.

Note: It is recommended to choose Professional or Enterprise Edition as the operating system.


5.2 EzCad3

The standard computer hardware required for the operation of EzCad3 software: dual-core CPU, memory 2G, hard disk 10G, dual native USB interface. The computer system software is Microsoft Windows operating system WIN7 64-bit, WIN8 64-bit and WIN10 64-bit. The default operating system of the manual is Microsoft Windows.

EzCad3 software installation is very simple, users only need to copy the EzCad3 directory file on the installation CD directly to the hard disk. Then double-click the EzCad3.exe running software in the EzCad3 directory that has been installed. The computer must be authorized before the software runs, otherwise the software will not run normally.

32

USER'S MANUAL

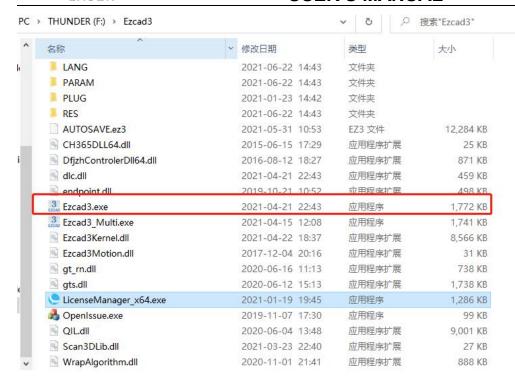



The Software, Drive and Calibration file are in the U-disk that came with the fiber machine.

5.2.1 Driver Installation


Turn on the fiber laser


- 1. Connect your fiber laser with PC via USB cable.
- 2. Before moving on to next step, please save the Driver file in the U-disk to your computer, and remember where it is.




3. Go Manage>>Device manager>>Other devices>>DLC1000>>right click, Update driver>>Browse my computer for driver software>>Browse, and find the DLC1000 folder you saved from the U-disk that came with the fiber laser>>Select the DLC1000 driver>>Next>>Install, then the driver is installed successfully. See below pictures.




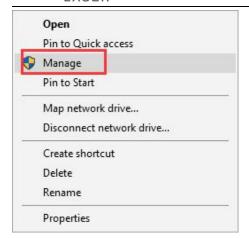

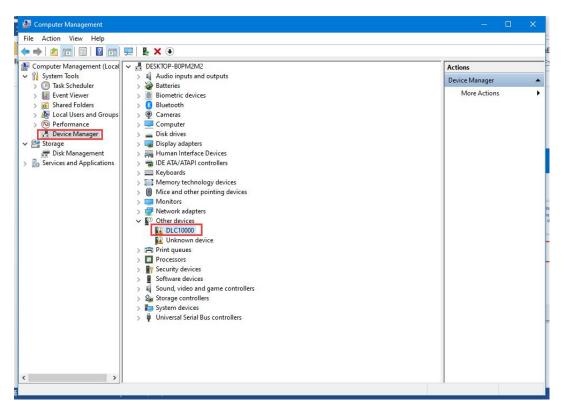





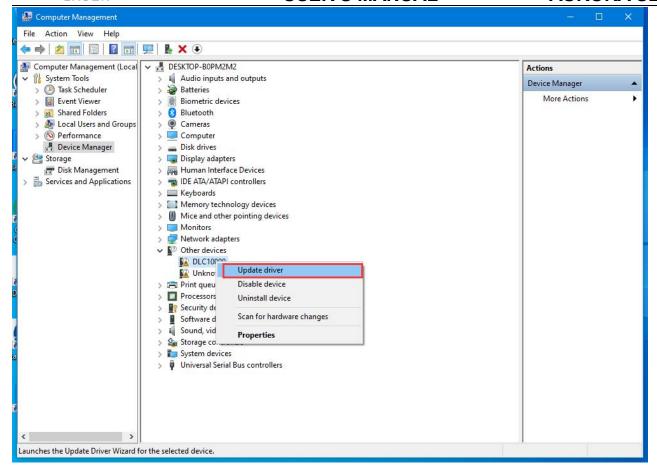

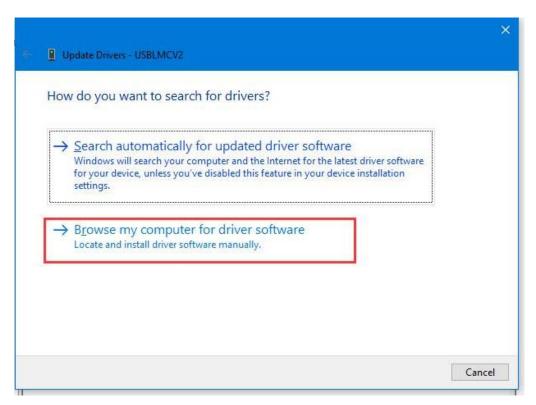




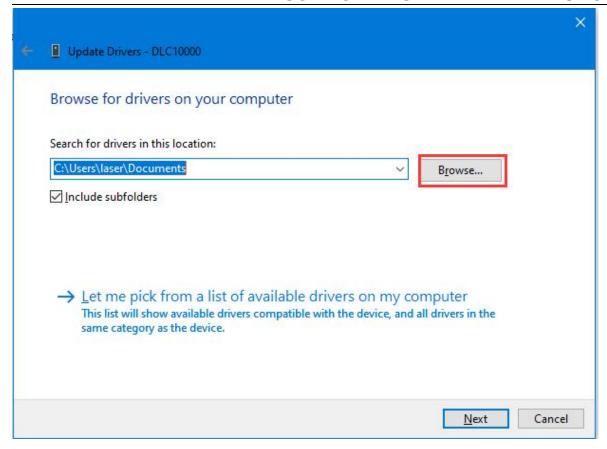


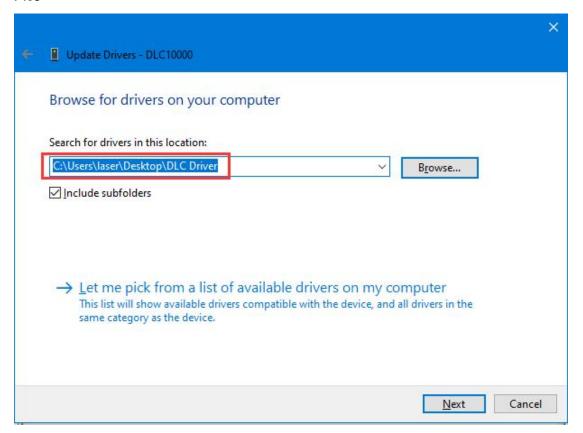



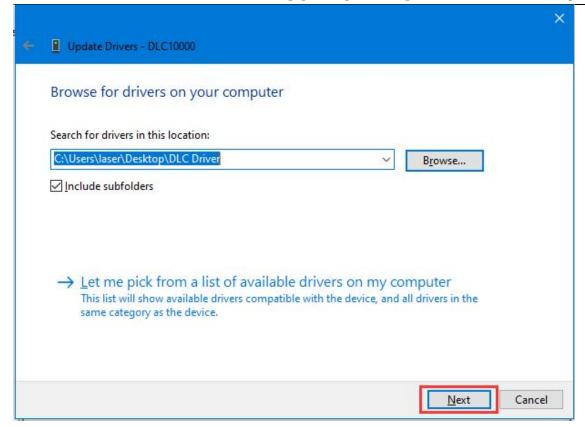


Pic7

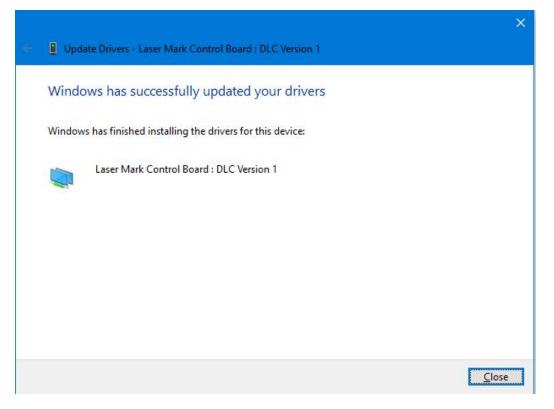

Pic8



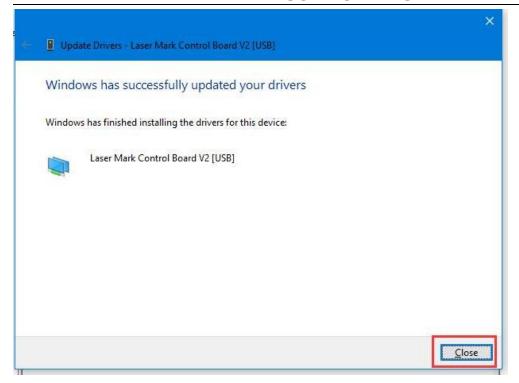

Pic9




5.2.2 Activate the software

EzCad 3 needs to be activated before initial use.

Activating process


The activation code is inside the text file.

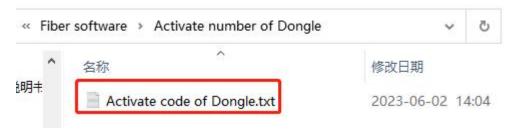

You can find it in the U disk that come with the machine.

The dongle that came with the machine, with a string of activation codes on the back side. It's already inserted into the machine, as shown below:



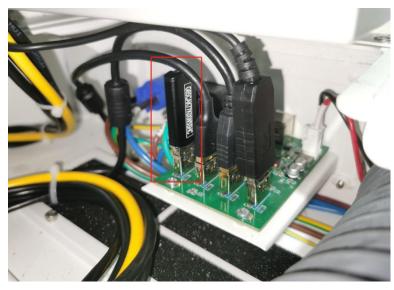

Don't unplug it!

www.thunderlaser.com tech@thunderlaser.com Tel:(86) 18103043363









The activation code can only activate 5 computers!!!

- 1. Find the activation code and copy it.
- 2. Open the activated software LicenseManager X64 in fiber software folder.

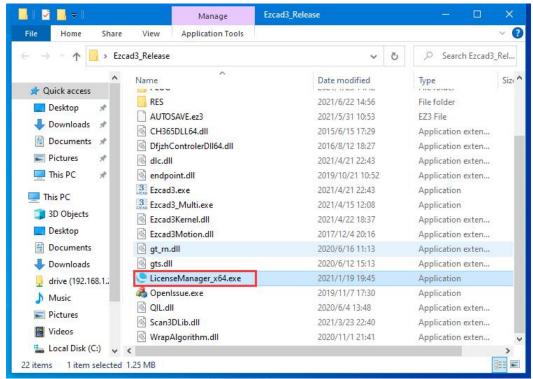



Click License activation icon

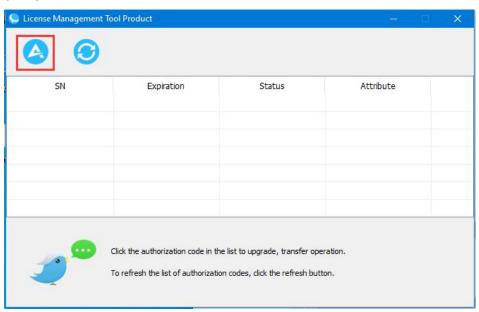


4. Click "online activation via the internet" and click "ok"


www.thunderlaser.com tech@thunderlaser.com Tel:(86) 18103043363






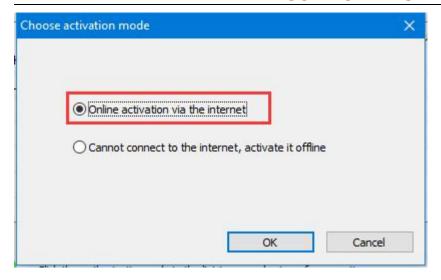


5. Click "Get the activation request file" and enter the activation code that you record. Then click "OK".

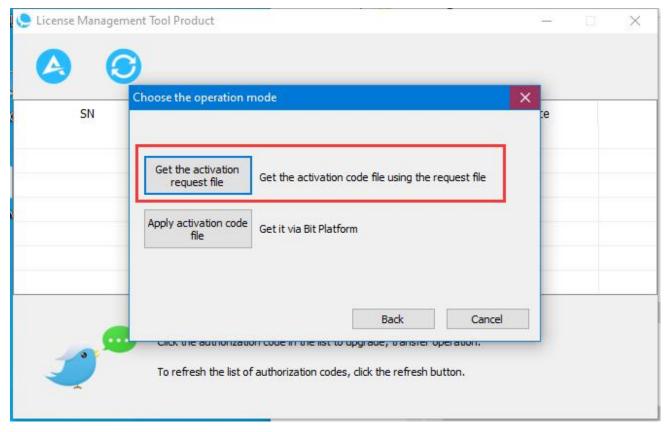



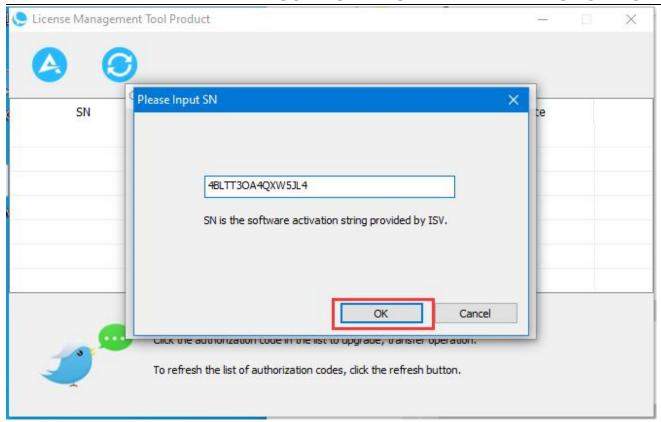


6. Then it will show "Activate SN successfully".

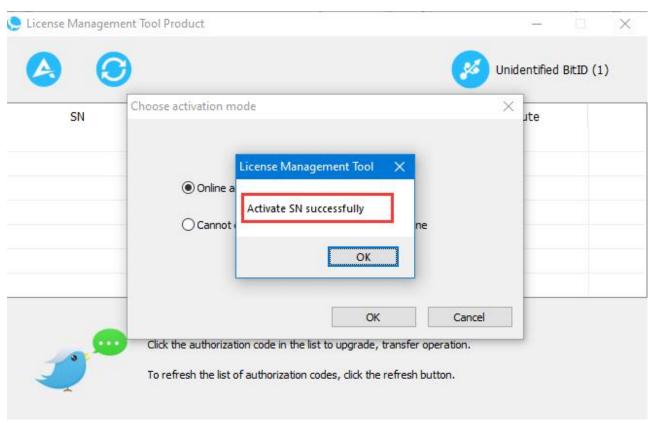



7. Now, the SN is activated successfully.

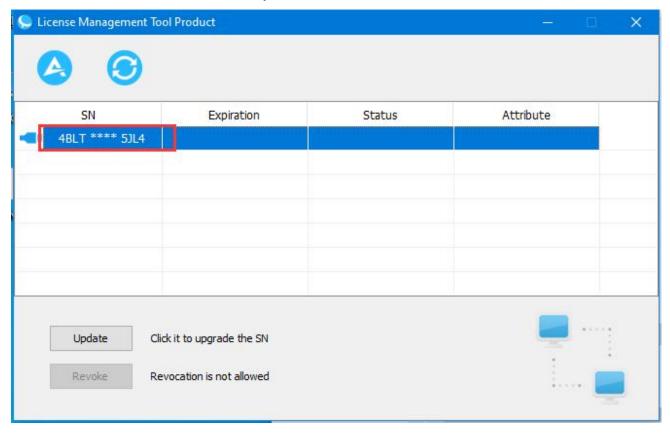

8. Then you can open the EzCad3 software.

5.2.3 Software setting

1. General setting

We have made the correct settings in the software before the machine leaves the factory.

Please open the software to check if they are correct.

Open the software, then press "F3" and select items according to the picture below (take MOPA 20W as an example) .

Laser type: FIBER

Frequency(kHz):


Min Value:1, Max Value:4000.

FIBER:

Type: IPG_YLPM(Type:D)



USER'S MANUAL

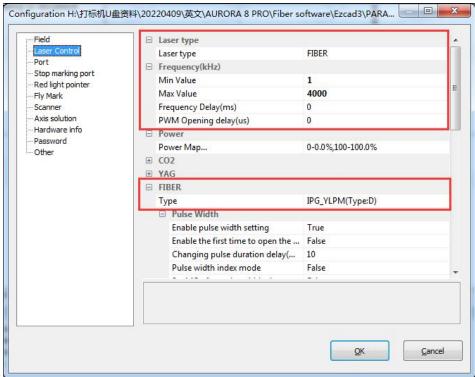



The frequency ranges for different laser source.

UV laser	5W					
Fiber laser		20W	50W			
MOPA laser				20W	60W	
Frequency	20-150kHz	20-60kHz	50-100kHz	1-4000kHz		

2. How to import the correction file.




- 1. Before leaving the factory, we have done a correction test for each machine and imported the calibration file to fiber software, so the customer does not need to calibrate again.
- 2. Different field lenses have different calibrate files and cannot be used randomly.
- 3. If you've purchased other field lens with the fiber machine, we will prepare the calibration file and put it in the U disk too.
- 4. If you've purchased other field lens after the machine left the factory, contact us to get the calibration file.

Open the software>>Press "F3" button>>Field>>find the calibration file (let's say the name is 9×9.cor) in the USB disk that came with the machine.

www.thunderlaser.com tech@thunderlaser.com Tel:(86) 18103043363





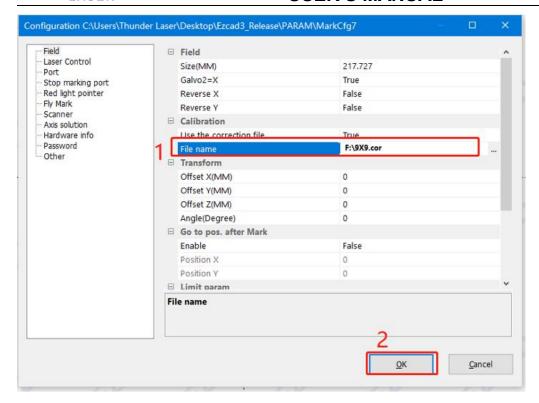

Chapter 6. How to set & adjust the focus length of Auto-focus

AURORA series marking machines can be equipped with 3 field lenses (F-160, F-220, F-290), UV laser is equipped with 2 field lenses (F-170, F-254), and the focal lengths of different field lenses are different. After changing the field lens, the user needs to adjust the focus of autofocus again.

How to set the focus length of Auto-focus


- 1. Connect machine and computer with the USB cable.
- Install USB driver: Right click "computer">>Management>>device manager>>Other devices>>USB Serial>>Update Driver>>Browse my computer to driver software>>Find the Driver folder that came with the machine CD340G-USB-Drive>>Next>>Install successfully.

Find the corresponding COM of the USB, and remember it.




The auto-focus software driver folder is in the U-disk that came with the Fiber machine.

USER'S MANUAL

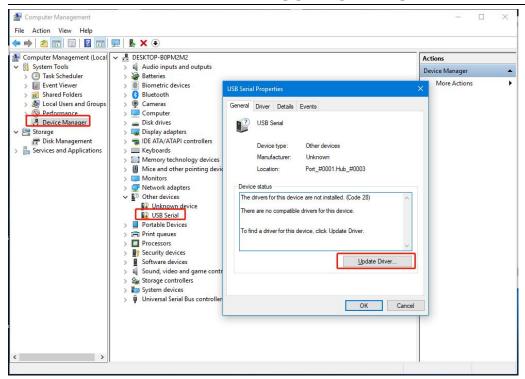


Pic1

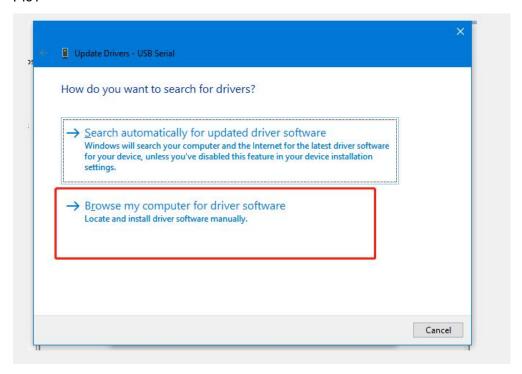


Pic2

46

USER'S MANUAL

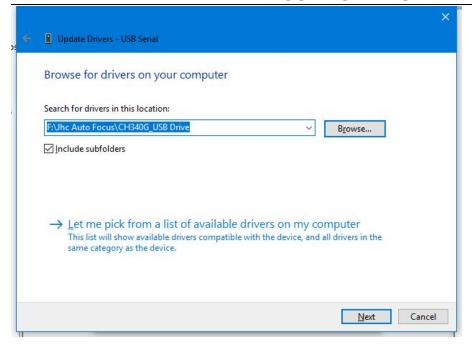

Pic3

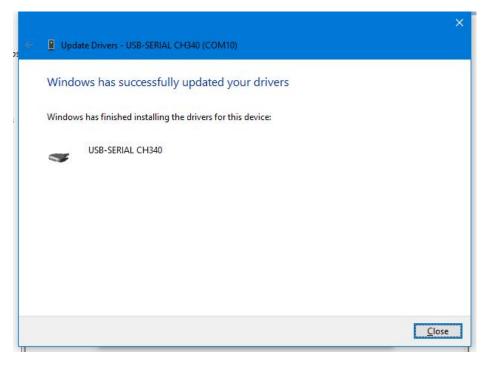


Pic4

4. Choose correct COM port and click connect, then set the screw pitch as 5, Pulse count as 5000. Speed as 2(divided into 9 gears, 1 fastest, 9 slowest, 1-9 speed decreasing), then click "Send", the window of "successfully set" will be presented. And input the focal length according to the reference form.

Focal Length for different lens (for reference only)



			710110101011								
	F-160	F-220	F-290	F-170(UV)	F-254(UV)						
AURORA 8	P:30%, S:100mm/s,										
Focus length	218.14~219.5	304.71~308.17mm	398.03~401.08mm	1	1						
range	2mm										
AURORA	F:50kHz, S:100mm/s, PW:1µs										
8(UV5W)											
Focus length		1	266~269mm	310.85~375.44							
range	mm										
AURORA 8	P:30%, S:100mm/s, PW:100ns										
PRO											
Focus length	220.56~222.6	303.84~306.56mm	395.52~397.1mm	1	1						
range	4mm										

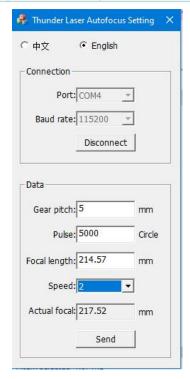

How to adjust the focus length

- 1. Install the USB driver first, and set the Screw pitch, Pulse count and Speed according to the steps in the last part **How to set the focus length**.
- 2. Open the marking software, place a piece of metal material on the working platform, draw a 10*10mm square in the software, set the marking parameters. It is recommended to set the speed to 100mm/s and the power to 30%. Low-speed marking makes it easier to observe changes in focal length. Click on the red light, align the




material, and click on the mark. During the marking process, press the up or down button of the marking machine to observe the beam. When the beam is at its brightest, the focus length is optimum. At the same time, it can be observed that the actual focal length column in the auto-focus adjustment software is constantly changing. Please record the actual focal length when the beam is at its brightest. About how to use the Fiber laser, you can refer to **Chapter 7.**

And the table below is for reference. You can input them in auto-focus software or adjust based on them.

	F-160	F-220	F-290	F-170(UV)	F-254(UV)						
AURORA 8	P:30%, S:100mm/s,										
Focus length	218.14~219.52mm	304.71~308.17mm	398.03~401.08mm	1	1						
range											
AURORA	F:50kHz, S:100mm/s, PW:1µs										
8(UV5W)											
Focus length	/ 266~269mm 310.85~375.44mi										
range											
AURORA 8	P:30%, S:100mm/s, PW:100ns										
PRO											
Focus length	220.56~222.64mm	303.84~306.56mm	395.52~397.1mm	1	1						
range											

3. Input the recorded real focal length value into the input box of setting focal length, click "send" again, the software will return to the successful setting, the parameters will be stored by the software, and the system will automatically move to this position by clicking the auto-focus button again.

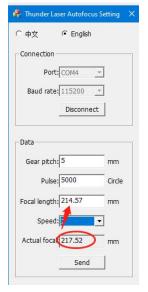

www.thunderlaser.com tech@thunderlaser.com Tel:(86) 18103043363

49



Chapter 7 The First Time to Run the Fiber Laser

7.1 The first time to run a fiber laser




For your safety, never ever run the laser system unattended.

Your first marking test (take AURORA 8 PRO, MOPA 20W, Lens F-290 as an example)

The following steps describe how to successfully engrave a pattern for the first time. Please follow the steps:

- 1. First ensure that the exhaust fan, computer and all mains are connected.
- 2. Turn on the key switch and emergency button.

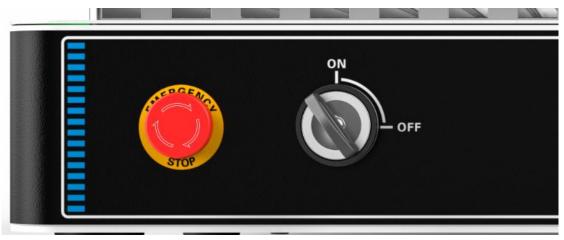



button to initialize the machine.

3. Place the material on the working platform.





4. Open the software EzCad3, then install driver and import the calibration file according to Chapter

5.2.3.

Please must follow the steps to turn on the machine:

Turn on the machine>> turn on the software, otherwise the software cannot connect with the machine.

5. Import your file to EzCad3





This software supports these file types.

Vector Files


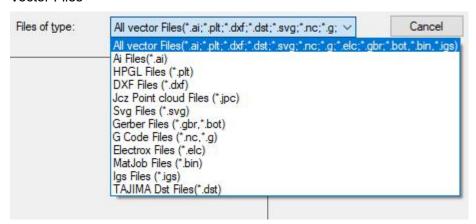


Image Files


www.thunderlaser.com tech@thunderlaser.com Tel:(86) 18103043363



USER'S MANUAL

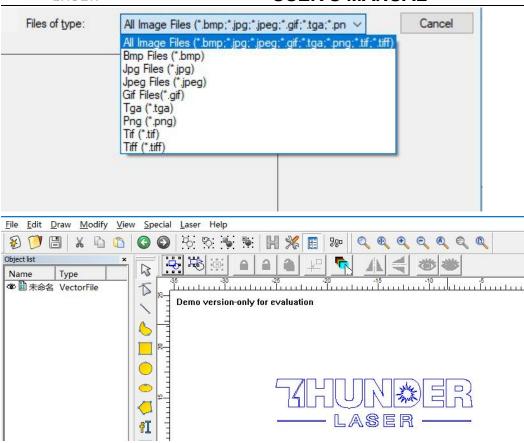


6. Press "Hatch", choose Hatch1(or you can choose the others as you need), set the Line space as 0.05mm (we recommend the range of 0.01-0.1mm), then press "OK".

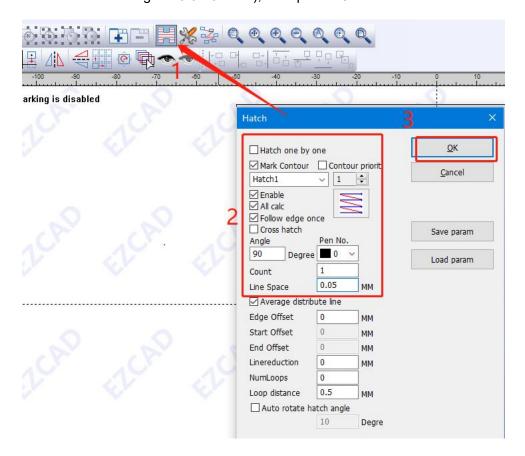

www.thunderlaser.com tech@thunderlaser.com Tel:(86) 18103043363





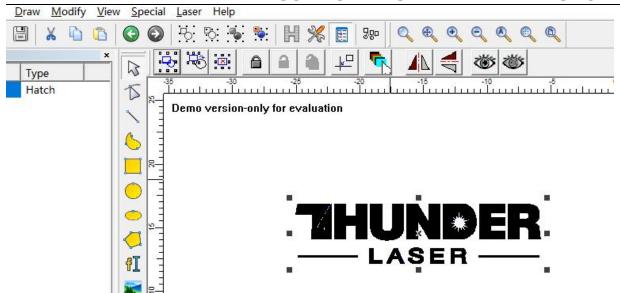

7. Set the marking parameters for your file. Adjust parameters as needed (you need to unselect "use the default para" for changing the parameters).

Set the Loop Count to 1, Speed to 1800mm/s, Power to 50%, and Frequency to 300KHz, Pulse width to 200ns.

Start TC(US) to 150, Laser Off TC(US) to 140, End TC(US) to 300, Polygon TC(US) to 100.


Other settings needn't to change.



For different watts, the frequency range is different, please refer to the table below.

UV laser	5W					
Fiber laser		20W	50W			
MOPA laser				20W	60W	
Frequency	20-150kHz	20-60kHz	50-100kHz	1-4000kHz		



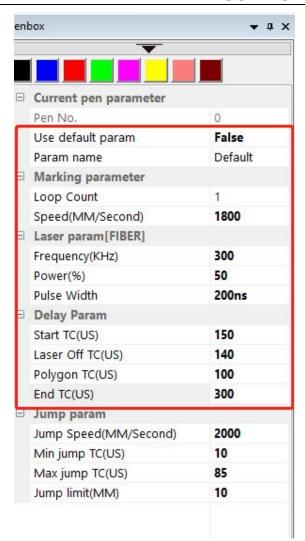

8. You can see a red dot on the work area, which comes from the galvanometer. So please put your material under the red dot, then press the "Auto focus" button. The galvanometer will adjust the focus distance automatically, which will last for 2-3 seconds. After hearing a beep (from the indicates light), the focus distance adjustment is complete.

54








9. Press Key F1 or Red(F1) in software, then fiber will virtually mark out the size of your file. Adjust the position of your material according to the red area. See pictures below.





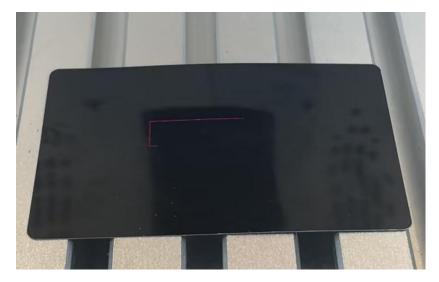

10. Close the door and press Key F2 or Mark(F2) in software. Or press "start" button to mark.





- 1. The controller can record the last file, if you want to run a file twice or more, you can just press "Start" button of the fiber machine.
- 2. You can start to mark with "Start" button also.
- 11. The fiber laser will mark your image.







7.2 The first time to run a UV laser




For your safety, never ever run the laser system unattended.

Your first marking test (AURORA 8, Lens F-170)

The following steps describe how to successfully engrave a pattern for the first time. Please follow the steps:

- 1. First ensure that the exhaust fan, computer and all mains are connected.
- 2. Turn on the key switch and emergency button.

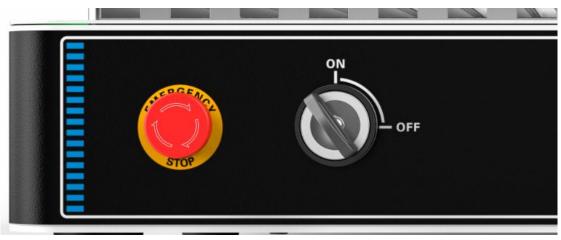

3. Place the material on the working platform.




4. Open the software EzCad2, then install driver and import the calibration file according to Chapter 5.2

Please must follow the steps to turn on the machine:

Turn on the machine>> turn on the software, otherwise the software cannot connect with the machine.

5. Import your file to EzCad2



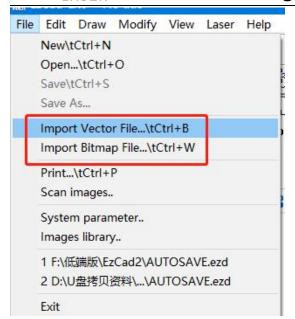



This software supports these file types.

Vector Files

```
All vector Files(*.ai;*.plt;*.dxf;*.dst;*.svg;*.nc;*.g;*(

All vector Files(*.ai;*.plt;*.dxf;*.dst;*.svg;*.nc;*.g;*gbr)

Ai Files(*.ai)

HPGL Files (*.plt)

DXF Files (*.dxf)

Jcz Point cloud Files (*.jpc)


svg Files (*.svg)

G Code Files (*.nc,*g,*gbr)


Gerber bot Files (*.bot,*.gbr)

TAJIMA Dst Files(*.dst)
```


Image Files

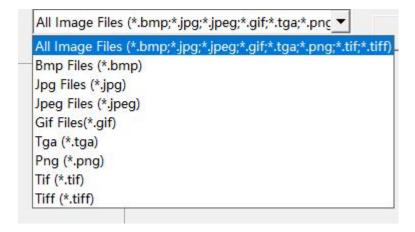




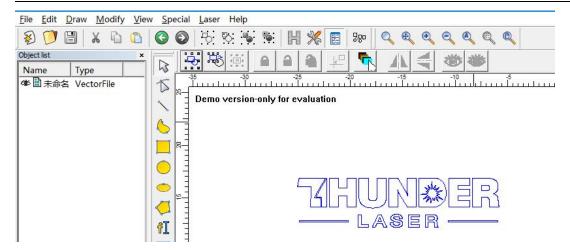

6. Press "Hatch", choose Hatch1(or you can choose the others as you need), set the Line space as 0.025mm (we recommend the range of 0.01-0.1mm), then press "OK".

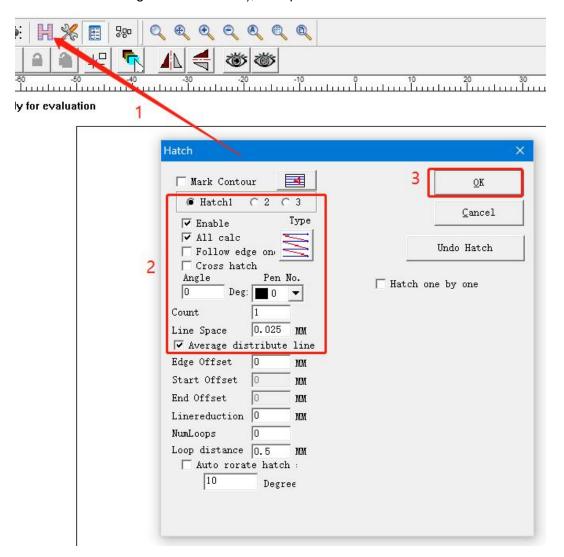



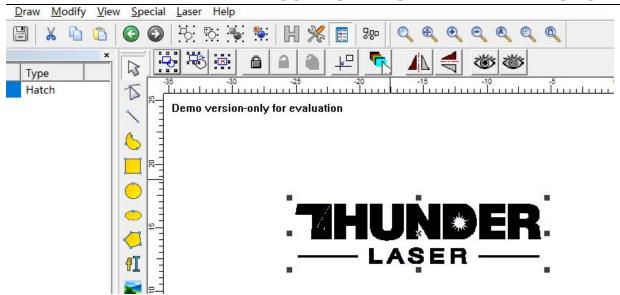

7. Set the marking parameters for your file. Adjust parameters as needed (you need to unselect "use the default para" for changing the parameters).

Set the Loop Count to 1, Speed to 1200mm/s, Frequency to 50KHz, Q-Pulse width to 5µs.

Start TC(US) to 0, Laser Off TC(US) to 120, End TC(US) to 100, Polygon TC(US) to 100.


Other settings needn't to change.



For uv laser source, the Q-pulse different watts, the frequency range is different, please refer to the table below.

F(kHz)	20	30	40	50	60	70	80	90	100	110	120	130	140	150
PW(μs)	<50	<33.33	<25	<20	<16.67	<14.29	<12.5	<11.11	<10	<9.09	<8.33	<7.69	<7.14	<6.67




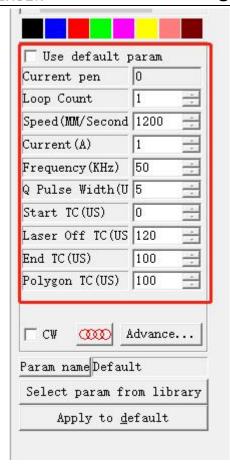


8. You can see a red dot on the work area, which comes from the galvanometer. So please put your material under the red dot, then press the "Auto focus" button. The galvanometer will adjust the focus distance automatically, which will last for 2-3 seconds. After hearing a beep (from the indicates light), the focus distance adjustment is complete.

61



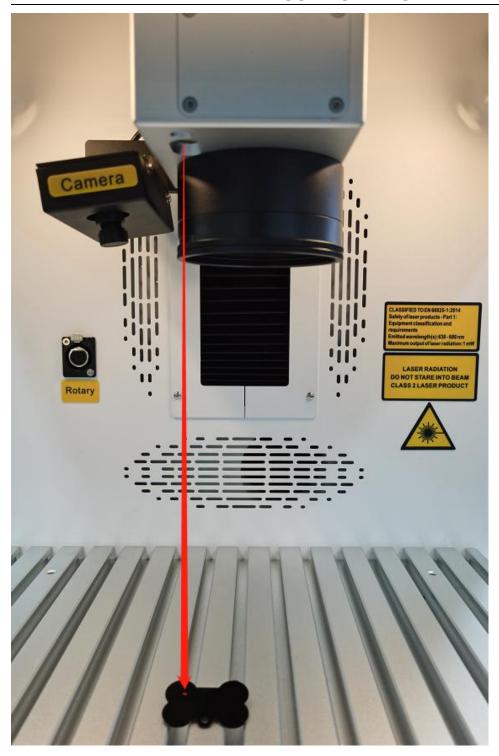

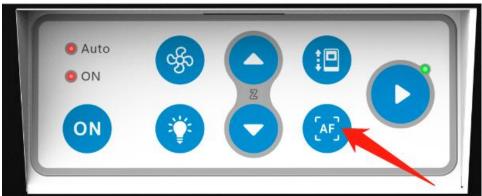



9. Press Key F1 or Red(F1) in software, then fiber will virtually mark out the size of your file. Adjust the position of your material according to the red area. See pictures below.



10. Close the door and press Key F2 or Mark(F2) in software. Or press "start" button to mark.





- 1. The controller can record the last file, if you want to run a file twice or more, you can just press "Start" button of the fiber machine.
- 2. You can start to mark with "Start" button also.
- 11. The laser will mark your image.





Chapter 8 Maintenance

8.1 General Maintenance


Caution-Before any maintenance efforts takes place, ensure that the power supply has been cut off and the system is powered off.

All maintenance efforts must be carried out according to the safety regulations.

In order to ensure the maximum availability and lifespan of the system, we recommend that you regularly check the ventilation and keep the surrounding area clean.

Lubricating the rotary

It is suggested to add lubricant oil (or Rust Preventative Grease) to the chuck at least every two weeks.

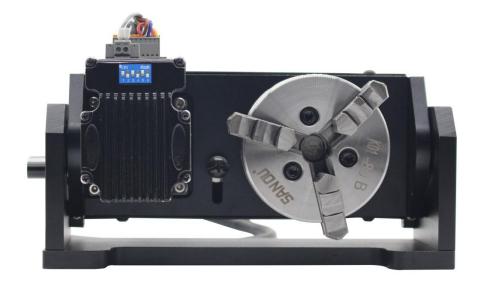

8.2 Clean the Field lens

This system is equipped with high-quality optical components, which, under normal operating conditions, are free for maintenance within their lifespan. However, it may be necessary to clean output lenses, e.g. the scanner flat field lens (f-theta objective) needs cleaning if it is covered in dust or fumes.

- 1. Never touch the optical components with your fingers! Oily or dirty hands may damage the surfaces of lens.
- 2. Do not use any tools or hard objects to clean the surfaces. Scratches cannot be repaired.
- 3. Blow away large pieces of dirt by blowing up a balloon.





4. Spray the cleaning solution onto the Q-tip, and remove the remaining stains with it.



- 5. Distribute the cleaning fluid carefully by small circular motions. Start with the center of the lens and move outwards to the edge. Keep moving the Q-tip until the entire surface is clean.
- 6. Clean it again with a new clean and dry cotton swab.
- 7. Make sure that no water or stains remain on the surface of the lens after cleaning.
- 8. Do not wipe the lens with a dry cloth.
- 9. Do not exert any pressure on the lens.
- 10. Clean once half a year (depended on the usage).

The End.